



Motor Bearing Protection Guide

Defining the added benefits of the dV Sentry™ versus a shaft grounding brush

What's a Shaft Grounding Brush?

A common method across industries is to use a shaft grounding brush or ring to protect motor bearings from common mode over voltage. A shaft grounding brush is not a filter, so it does not help reduce or protect equipment from the actual problem. The current is detected around the motor bearing to an alternative route, thus the current still exists and can cause widespread damage in many other areas in the system.

Effects of Using a Shaft Grounding Brush

Due to their design and placement on motors, shaft grounding brushes have long term costs. The position and contact of these products with the shaft make them prone to wear and a shorter life span, and are not always easy to replace. A shaft grounding brush is also subjected to high levels of oxidation which causes the product to reduce its ability to divert currents from VFDs. All of which result in higher maintenance costs.

One of the most problematic issues in using a shaft grounding brush is that it does not reduce the effects associated with common mode over voltage, fast rise time, and peak voltages. This issue can cause failures to surrounding equipment such as: erratic behavior of VFDs and PLCs, insulation failure leading to motor overheating, and unwanted ground faults.

Unresolved Issues Associated with a Shaft Grounding Brush:

- Unexpected ground fault trips
- Erratic behavior of VFDs and PLCs
- Premature motor insulation failure
- Cable damage

Destructive Waveforms

Common Mode Over Voltage

VFDs give off power in a continuous generation of pulses, which on average achieve a sinewave. However, the sum at any point is not always zero, which results in damaging common mode over voltage. This can cause motors to break down over time.

Peak Voltages

The pulse of VFDs is not a clear square pulse. Each rise and fall of the pulse has an over shoot or transient over voltage. This phenomenon is also known as a "reflected wave." These voltage spikes, especially in long cable leads, can reach dangerous levels and damage drives and motors.

Rise Time

Modern VFDs utilize IGBT systems that create extremely fast rise times which can increase motor performance. However, this can also result in increased motor insulation heating, which can reduce motor life in the long run.

The Best Solution for Motor Protection is the dV Sentry™


The dV Sentry™ is the only filter on the market that features a one of a kind patented Triple Defense Core that is proven to reduce common mode current by 50%. Also, the Triple Defense Core helps reduce peak voltages and rise time. No other filter on the market can make the same claim.

The dV Sentry™ is the only proven filter to provide common mode reduction, peak voltage protection, and rise time reduction – all in one unit.

The dV Sentry's Unique Patented Triple Defense Core

The patented design of the dV Sentry™ and its Triple Defense Core are like nothing you've seen before.

- **Common mode reduction:** Filters power through the outer core and reduces common mode current.
- **Peak voltage protection and rise time protection:** Power filters through inner core, reduces rise time and gives peak voltage protection.

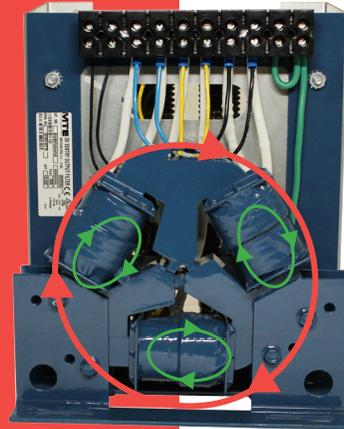

dV Sentry vs. the Rest

The dV Sentry outperforms the competition with proven results. Of the three filters tested, a typical dV/dt filter, a common mode choke, and the dV Sentry filter, the dV Sentry showed that it was a standout among the competition. Each filter was tested using a 480V, 50hp drive system with 1,000 feet of cable, 8kHz switching frequency, and at full load. While many of the competitors claim to reduce common mode voltage, they fail to back it up.

Want to learn more?

Visit mtecorp.com to view the following:

- White paper for detailed specifications about Common Mode and its effects
- dV Sentry video
- More power quality solutions from MTE

Filtering	Filter Common Mode Dampening	Change in Common Mode Current	Note
Typical dV/dt Filter	N/A	-5%	Negligible Common Mode Filtering
Common Mode Choke	None	18%	Unreliable Common Mode Filtering
Shaft Grounding Brush	N/A	0%	Can Protect Bearings
MTE dV Sentry Filter	Optimal	-47%	Reliable Common Mode Filtering



Power quality. Solved.

MTE Corporation

N83 W13330 Leon Road • Menomonee Falls, WI 53051
 (800) 455-4MTE • (262) 253-8200 • mtecorp.com